

Fire Risk Assessment 1-29 Kinver House

Version 7

20 September 2024



Next Assessment Due: 30 September 2025

Risk Score: Moderate Risk

Assessor: Jacob Troth

Contents

1	Action Plan Summary	3
2	2 Introduction	8
3	B Executive Summary	9
	Premises Details	
5	Fire Prevention	14
6	Escape Routes & Fire Spread	17
	Detection & Warning	
	Firefighting	
	Lighting	
10	0 Signs & Notices	26
	1 Fire Safety Management	
	2 Tasks	
1:	3 Risk Score	35

Action Plan Summary

Task No.	Category	Sub Category	Action Required	Priority	Status	Action Taken	Date Completed
1	Escape Routes & Fire Spread	Fire Doors	Install smoke seals on the following doors: Flat 28 Version 2: Attempts were made to access this flat, however it was not possible and therefore it cannot be confirmed if the remedial work recommended in this task has been completed.	Low	Identified		
			VERSION 4: access was not possible into this flat to assess whether this recommended remedial work has been completed. Version 7, 20/09/2024 Accessed flat, no smoke seals present. This task remains outstanding.				

2	Escape Routes & Fire Spread	Ease of Use	Although the amount of items currently in escape routes is not unreasonable, routes should be monitored to ensure that a build-up of items does not impede escape.	Advisory	Identified
			Shoes and other items outside of flat 13.		
			VERSION 4:		
			Timber on fourth floor corridor.		
			Version 7, 20/09/2024 Timber removed from fourth floor, shoes remain outside flat 13. This task remains outstanding.		
3	Signs & Notices	Fire Door Signage	The staircase door on the first floor has a "fire door keep locked" sign fixed. This should be replaced with a "fire door keep shut" sign.	Low	Identified
			VERSION 3: this task is yet to be completed.		
			Version 7, 20/09/2024 This task remains outstanding.		

4	Signs & Notices	Fire Door Signage	Provide Fire Door Keep Closed signs on the following doors: A "Fire Door Keep Closed" sign should be fixed to both sides of the self closing staircase door on the third floor Version 7, 20/09/2024 This task remains outstanding.	Low	Identified
5	Escape Routes & Fire Spread	Fire Doors	The following doors should be kept locked shut: VERSION 3: the doors to the gas meter cupboards, located in the bin-store, should be kept locked shut. Version 7, 20/09/2024 This task remains outstanding.	Medium	Identified
6	Fire Prevention	Housekeeping	The electrical cupboard on the ground floor is currently being used to store cleaners equipment and chemicals. This should be removed. Version 7, 20/09/2024 Lock changed to a non-standard lock so access cannot be gained to verify if completed. As a result this task remains outstanding.	High	Identified

7	Fire Prevention	Lightning	The lightning protection should be periodically inspected by a competent person, to the frequency recommended in BS EN 62305. Version 7, 20/09/2024	Medium	Identified
			Unable to verify on site if this has been completed. This task remains outstanding.		
8	Escape Routes & Fire Spread	Construction and Glazing	Carry out the following recommendations of the CHPKFE report:	High	Identified
			- Installation of suitable and sufficient cavity barriers behind the top floor of the metal cladding		
			- Capping of the sandwich cladding panels where cut to enclose the exposed insulation.		
			Version 4, 20/09/2024 Nothing on site to suggest this has been done. This task remains outstanding.		

9 Escape Routes & Construction and Should it become apparent that the timescale High Identified for the completion of the CHPKFE Fire Spread Glazing recommended remedial work is to be protracted beyond reasonable timescales, then additional interim fire safety measures should be considered in line with the NFCC Guidance Document "Simultaneous Evacuation Guidance-Guidance to support a temporary change to a simultaneous evacuation strategy in purpose built blocks of flats"

Version 7, 20/09/2024

outstanding.

Stay put guidance remains. This task remains

Introduction

This report presents the findings of a fire risk assessment carried-out at the premises by QFSM Ltd. The scope, format and limitations of the fire risk assessment have been discussed and agreed with the client.

The scope of the assessment does not include individual dwellings. Notwithstanding any statement or recommendation made with respect to smoke/heat alarms within dwellings, it is always recommended as best practice to ensure that working smoke alarms are provided in all dwellings at least to a BS 5839-6 Category LD3 standard. These should ideally be Grade D1 alarms (mains powered with integral battery back-up), although Grade F1 alarms (battery powered only) are a reasonable short term measure.

The report includes an action plan which contains recommended tasks, each with a suggested due date. These due dates are only our suggestions, and may or may not be appropriate, depending on individual circumstances such as financial constraints and requirements of enforcing authorities.

The premises risk score was assessed at the time of the fire risk assessment, and a recommended review date has been provided. The actual level of risk may change over time, as a result of tasks being completed, or new risks arising. Regardless of the review date, the fire risk assessment should be reviewed regularly so as to keep it up to date and particularly if:

- there is reason to suspect that the fire risk assessment is no longer valid; or
- there has been a significant change in the matters to which the fire risk assessment relates.

If you have any queries please contact QFSM Ltd at office@qfsmltd.co.uk.

Executive Summary

The previous FRA for this building was reviewed prior to this inspection, paying particular attention to any tasks generated by that FRA. During this inspection these tasks were inspected where access was possible, to ascertain if the recommended remedial work had been completed, and comments regarding the progress of any remedial work made accordingly.

This new version was created on 20/09/2024 and is not a review of the fire risk assessment. This is purely an on-site audit carried out at the request of the client to ascertain the progress of any action carried out against previous tasks identified in previous versions of this fire risk assessment.

Install smoke seals on the following doors:

Flat 28

Although the amount of items currently in escape routes is not unreasonable, routes should be monitored to ensure that a build-up of items does not impede escape.

Shoes and other items outside of flat 13.

The staircase door on the first floor has a "fire door keep locked" sign fixed. This should be replaced with a "fire door keep shut" sign.

Provide Fire Door Keep Closed signs on the following doors:

A "Fire Door Keep Closed" sign should be fixed to both sides of the self closing staircase door on the third floor.

The following doors should be kept locked shut:

The doors to the gas meter cupboards, located in the bin-store, should be kept locked shut.

The electrical cupboard on the ground floor is currently being used to store cleaners equipment and chemicals. This should be removed.

The lightning protection should be periodically inspected by a competent person, to the frequency recommended in BS EN 62305.

CHPK Fire Engineering Ltd have produced a report, "Fire Safety Review of External Walls and Attachments" dated 2 June 2021, following their intrusive survey of the external walls of this building.

They have identified that the building has 3 main external wall types, and these are detailed on p9 of their report.

They have concluded that in the event of a fire, Wall Types 1 and 2 would be unlikely to result in the fire spreading either within the external wall cavity or across the surface of the external wall.

They have concluded that in the event of a fire, Wall Type 3 would be unlikely to result in the fire spreading across the surface of the wall, but may allow fire spread within the external wall cavity. This wall type is found to the top floor penthouse elevations only.

Given the existing fire safety measures within this building, whilst the overall risk may be considered low, CHPK would conclude that the overall fire risk due to the external wall and balconies is moderate. The potential life safety consequences are considered moderate which is where a fire could result in injury to one or more occupants, but unlikely to involve multiple fatalities.

ISHA have stated (23.09.21) that they do not yet have a confirmed timescale for remedial works to commence on this building. They are in the process of obtaining high level quotes for the recommended remedial work. Should it become

apparent that the timescale for he completion of this work is going to be protracted, then additional interim fire safety measures should be considered in line with the NFCC Guidance Document "Simultaneous Evacuation Guidance-Guidance to support a temporary change to a simultaneous evacuation strategy in purpose built blocks of flats".

Carry out the following recommendations of the CHPKFE report:

- Installation of suitable and sufficient cavity barriers behind the top floor of the metal cladding
- Capping of the sandwich cladding panels where cut to enclose the exposed insulation.

Should it become apparent that the timescale for the completion of the CHPKFE recommended remedial work is to be protracted beyond reasonable timescales, then additional interim fire safety measures should be considered in line with the NFCC Guidance Document "Simultaneous Evacuation Guidance-Guidance to support a temporary change to a simultaneous evacuation strategy in purpose built blocks of flats"

Until the remediation work is completed on the external walls, these tasks will remain outstanding.

Giving consideration to the general fire safety arrangements within the building, and the tasks recommended as detailed within this report, it is assessed that this building presents a moderate risk.

Premises Details

Address line 1	1-29 Kinver House
Address line 2	42 Elthorne Road
Town	Islington
Postcode	N19 4AS
FRA Type	Type 1 - Common parts only (non-destructive)

Description

Client

A Type 1 fire risk assessment has been conducted at this building. This means the inspection of the building has been non-destructive. As well as considering the arrangements for means of escape, the fire risk assessment has included, where possible, the examination of a sample of flat entrance doors. It has also considered, so far as reasonably practicable, the separating construction between the flats and the common parts without any intrusive examination of construction. This Type of fire risk assessment has not involved entry to flats beyond the area of the flat entrance door.

	ISHA
Building Information	
Use	Purpose-built, self-contained flats
Number of floors - ground and above	5
Number of floors - below ground	0
Number of flats	29
Number of stair cores	1

Approach to flats

Approximate period of construction

Is the top occupied storey over 18 metres above access level?

- Via protected lobbies / corridors
- · Direct external access

2010-2020

No

Construction details

A building of five floors, of brick and concrete construction, containing 29 self contained flats.

2 flats have direct external access and 1 flat is accessed from the entrance hallway directly at the base of the staircase. The remainder of flats are accessed via protected corridors.

There is a single central protected staircase and a single car lift (not fire fighting).

The building has automatic ventilation provided in both the staircase and each corridor on each floor.



Timber rain screens around windows.



Rendered external wall surface




External walls – rear elevation



Cladded external wall system installed on fourth floor.



End elevation

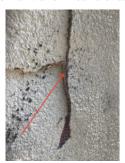

Showing insulated material beneath rendered surface.



Insulated material beneath external rendered surface.

External wall details

The external walls on the ground, first, second and third floors are rendered. The substrate to which this render has been applied cannot be confirmed within the scope of this fire risk assessment, however the external wall on the side elevation has suffered a vehicle impact near the rear gates, the damage caused by this impact exposes some form of insulated core material to which the render has been applied.

Windows have timber rain screens to one side. The fourth floor appears to have a cladded external wall system fitted, Access was not possible within the scope of this fire risk assessment to confirm the composition of this cladding material. Side elevation is fully rendered. The rear elevation of the building is fully rendered aside from the fourth floor.

VERSION 5:

Following an intrusive survey of the external walls of this building by CHPKFE Ltd, they have identified three main external wall types. These are detailed on p9 of their report dated 2 June 2021.

Attention is drawn to the Ministry of Housing, Communities & Local Government Consolidated Advice Note for building owners of multi-storey, multi-occupied residential buildings, dated January 2020. The Advice Note recommends that building owners should consider the risk of external fire spread as part of the fire risk assessment for multi-occupied residential buildings. Consideration has been given to this matter within this fire risk assessment. The Advice Note further recommends the assessment of the fire risks of any external wall system, irrespective of the height of the building.

Are there any private balconies?	Yes		
Private balcony details			
Concrete base, with glazed up-stands.			
People			
Are there any people especially at risk from fire?	Not Known		

Fire Prevention

Electrical

Are electrical installations and appliances free from any obvious defect?

Yes

Are fixed installations periodically inspected and tested?

Not Known

Are portable electrical appliances used?

No

Comments

It is understood that all electrical installations are within a robust testing programme and all records of testing are held centrally at ISHA.

There are electrical sockets in the common areas, presumably for use by cleaning staff. These were in good condition and showed no evidence of misuse by residents or visitors.



Electrical sockets in common areas.

Gas

Are gas installations and appliances free from any obvious defect?

Yes

Is gas equipment protected/located so as not to be prone to accidental damage?

Yes

Comments

Gas meters are located externally and not in any common areas.

Heating Are fixed heating installations free from any obvious defect? N/A Are portable heaters used? No Comments There is no heating provision in the common areas. Cooking Does cooking take place on the premises? No Comments Cooking takes place within flats only and does not take place in the common parts. Arson Is security against arson reasonable? Yes Is there a reasonable absence of external fuels and ignition sources? Yes Comments Access is made into the building via a secured main entrance door. All entrances are fob operated. CCTV cameras are installed internally and externally. Whilst these cameras may have been installed for security purposes they also serve to reduce the risk of deliberate fire setting. Housekeeping Is accumulation of combustibles or waste avoided? No

Comments

It was identified during the previous fire risk assessment that a pram was located directly outside of flat 23. This was not present during this inspection, however residents should continue to be reminded to keep escape routes clear of combustible items.

Are there appropriate storage facilities for combustible & hazardous materials?

The electrical cupboard on the ground floor is currently being used to store cleaners equipment and chemicals. This should be removed.

N/A

Building Works Are there any hot works being carried-out at this time? No Are the premises free of any obvious signs of incorrect hot work procedures in Yes the past? **Smoking** Are there suitable arrangements taken to prevent fires caused by smoking? Yes Comments Although there is no "No Smoking" signage provided, there is no evidence of cooking taking place in the common parts of the building. **Dangerous Substances** Are dangerous substances present, or liable to be present? No Lightning Is a lightning protection system installed? No Comments

The Electricity at Work Regulations state that Lightning Protection systems should be serviced and maintained in accordance with the recommendations of BS EN 62305 at maximum intervals of twelve months. The system, including all lightning conductors and earth grounding installations, should be visually inspected and tested by a suitably qualified electrical engineer.

Other Fire Hazards

Escape Routes & Fire Spread

Ease of Use

Are exits easily and immediately openable?	Yes
Do fire exits open in direction of escape where necessary?	N/A
Are escape routes unobstructed and safe to use?	Minor Defects
Are there reasonable measures for the evacuation of disabled people?	Yes

Comments

No specific occupancy risk identified. Tenants are a typical cross section of public and would include visitors and contractors. It is assumed occupants are capable of using the means of escape, unaided to reach a place of ultimate safety.

Although the amount of items currently in escape routes is not unreasonable, routes should be monitored to ensure that a build-up of items does not impede escape. This should include the removal of the electric mobility buggy on the ground floor within escape route and stairwell.

Dimensions

Are travel distances reasonable?	Yes
Is there sufficient exit capacity?	Yes

Fire Doors

Doors which are expected to be fire resisting:	 Flats Risers Staircases
Flat Doors	• FD30S self-closing
Riser Doors	• FD30S
Staircase Doors	• FD30S self-closing
Are fire doors to a suitable standard?	Minor Defects
Is there suitable provision of self-closing devices?	Yes
Is there suitable provision of hold-open devices?	N/A
Are doors kept locked where appropriate?	No

Comments

During the previous Fire Risk Assessment, access was gained into sample flats to assess the suitability of flat entrance doors, and any internal doors which open onto the entrance hallway.

Access was gained into flats 22, 23 and 28 which have an entrance door fitted to FD30S SC standard. The internal doors which open onto the entrance hallway also fire resisting. There are no cold smoke seals fitted to the entrance door of No.28. It was not possible to access flat 28 to confirm if this task has been completed.

The remainder of flat front doors within the building could not be assessed due to access. However, these all appear to be of the same age, condition and design of those which were accessed and were probably all installed at the same time. It is therefore reasonable to assume that they are of the same fire resisting standard.

The provision and condition of self closing devices, intumescent strips/cold smoke seals, and effective door closing action of these doors however could not be assessed and this should be confirmed ensure all doors afford FD30S SC standard of fire resistance.

Carpenters are on site adjusting and repairing doors and discussion with them revealed they are beginning a programme of reducing gaps and fitting intumescent strips where necessary to all fire resisting doors in communal areas including riser doors and staircase doors. They have no instruction to include flat entrance doors in this work at this time.

VERSION 3: the doors to the gas meter cupboards, located in the bin-store, should be kept locked shut.

VERSION 4:

Due to current government guidelines regarding the current COVID-19 pandemic, access into flats to confirm the provision and standard of fire resisting flat entrance doors was not possible. Inspection of flat entrance doors was made by external examination only, taking into account the age and condition of the doors, and where possible referring to previous FRAs where more detailed information regarding flat entrance doors and fire alarm provision may be found. All flat entrance doors appeared to be in good condition, with no obvious visible damage or defects and therefore it can reasonably assume they would afford the same level of fire resistance as found in the previous FRA.



Example of a flat entrance door.



Intumescent strips and cold smoke seals installed in riser doors.



CE1121 Door hinges in riser doors.

Construction & Glazing

Are escape routes protected with suitable walls and floors?	Yes
Is there adequate compartmentation?	Yes
Is there reasonable limitation of linings that might promote fire spread?	Yes
Glazing which is expected to be fire resisting, inc vision panels and fanlights:	• Staircases
Staircase Glazing	• 30 mins E
Is glazing reasonable and free from any obvious defects?	Yes

Comments

VERSION 1: Within each riser cupboard on each floor, there were cable and pipe penetrations through the cupboard construction which without intrusive examination outside of the scope of this Fire Risk Assessment, appears not be be fire stopped and could allow the passage of smoke and fire spread from these risers and into common parts of the building.

These should all be properly fire stopped.

Version 2: This work has been completed to an acceptable standard. Photographs provided as evidence.

VERSION 3: there appears to be a below ground level, accessed via grill plates at street level containing pipes and services into the building. It was not possible to access this level.



Acid etching on staircase door glazing



Example of installed fire stopping in riser cupboards.



Common balconies- Concrete base with glazed up-stands



Rendered external walls.

Dampers, Ducts & Chutes

Are there suitable measures to restrict fire spread via ducts and concealed spaces?

Yes

Comments

No dampers ducts or chutes evident.

Smoke Ventilation

Areas where smoke ventilation is expected:

- Corridors
- Staircases

Corridors

• Natural Vent into Shaft - Automatic

Staircases

• Natural Vent - Automatic

Is smoke ventilation reasonable and free from any obvious defects?

No

Comments

The manual smoke control on the 3rd floor is showing a flashing amber warning light.

This system should be serviced by a suitably qualified engineer to ensure it is operating correctly.

This is entered as a task within the "Fire Safety Management" section of this report.

Fire Risk Assessment 1-29 Kinver House Version 7

VERSION 3: This task has been completed.



AOV Provided in the staircase



Smoke Shaft door in corridors

Detection & Warning

Is an electrical fire alarm system expected?	No	
Why not?	Purpose-built flats	
Is a fire detection and/or alarm system provided?	Yes	
Areas covered	Communal areas	
Communal Areas		
System Category	• BS 5839 Pt1 Category L5	
Cause & Effect	Operates smoke ventilation	
Control Equipment		
Is the control equipment suitably located?	N/A	
Is the control equipment free from any obvious fault or defect?	N/A	
Manual Fire Alarms		
Are there sufficient means of manually raising an alarm?	N/A	
Are manual callpoints appropriately located and free from obvious defect?	N/A	

Automatic Fire Detection

Is there sufficient provision of automatic fire detection?	N/A
Is the type of automatic fire detection suitable and free from obvious defect?	N/A

Comments

VERSION 1: As part of the previous Type 3 Fire Risk Assessment access was gained into a sample flat to assess the provision and suitability of fire alarms.

Access was gained into flats 22, 23 and 28 which have a fire alarm provided to BS5839-6 LD2 standard.

It is always recommended as best practice to ensure that working smoke alarms are provided in all dwellings at least to a BS 5839-6 Category LD3 standard. These should ideally be Grade D alarms (mains powered with integral battery back-up), although Grade F alarms (battery powered only) are a reasonable short term measure.

VERSION 4:

Due to current government guidelines regarding the current COVID-19 pandemic, access into flats to confirm the provision and standard of fire alarms within flats was not possible.

Audibility

Are there adequate means of alerting all relevant persons?	N/A

Firefighting

Fire Extinguishers

Are fire extinguishers expected? No Why not? • Not practicable to train residents • Fire unlikely in communal areas Vandalism concerns Are fire extinguishers provided? No Is the provision of fire extinguishers reasonable? Yes **Fixed Systems** Are any fixed systems provided? No Is provision of fixed systems reasonable? Yes Fire Service Facilities Are any fire service facilities provided? Yes Types of facility · Smoke ventilation



Is provision of fire service facilities reasonable?



Floor numbers are clearly identified.

Yes

Lighting

Normal Lighting

Is there adequate lighting of internal escape routes?	Yes
Is there adequate lighting of external escape routes?	N/A
Is there adequate lighting in risk critical areas?	N/A
Emergency Lighting	
Method of emergency lighting of internal escape routes:	Maintained emergency lighting (local)
Is this provision reasonable?	Yes
Method of emergency lighting of external escape routes:	Borrowed light
Is this provision reasonable?	Yes
Method of emergency lighting of other areas:	Borrowed light
Is this provision reasonable?	Yes

Comments

Although this inspection took place during daylight hours, given the provision of street lighting in the immediate vicinity and lighting provided by surrounding buildings, it is reasonable to assume there would be sufficient borrowed light to aid escape in these areas.



Maintained EL provided in the staircase and escape routes.

Signs & Notices

Escape Routes

Is escape route signage necessary?	No
Why not?	 Simple escape routes Routes in ordinary use
Is escape route signage provided?	Yes
Is provision of escape route signage suitable?	Yes

Fire Doors

Is there signage suitable for self-closing fire doors?	Minor Defects
Is there signage suitable for locked fire doors?	Yes
Is there signage suitable for automatic fire doors?	N/A

Comments

The staircase door on the first floor has a "fire door keep locked" sign fixed. This should be replaced with a "fire door keep shut" sign.

A "Fire Door Keep Shut" sign should be fixed to the self closing staircase door on the third floor.



"Fire door keep locked" signage on riser cupboard doors

Other Signs & Notices

Is there suitable signage for fire service facilities?	Yes
Are fire action notices suitable?	No
Are there suitable notices for fire extinguishers?	N/A
Is there suitable zone information for the fire alarm system?	N/A

Comments

Provide fire action notices which confirm the action to take in the event of fire.

Fire Safety Management

Procedures & Arrangements

Current evacuation policy	Stay Put
Are fire action procedures suitable and appropriately documented?	Not Known
Are there suitable arrangements for calling the fire service?	N/A
Is there a suitable fire assembly point?	N/A
Are there suitable arrangements for the evacuation of disabled people?	Yes

Comments

These are general needs flats and as such no specific occupancy risk is identified. Tenants are presumed to be a typical cross section of public and could include visitors and contractors. It is assumed that all occupants and visitors are capable of using the means of escape unaided to reach a place of ultimate safety.

Training & Drills

Are staff regularly on the premises?	No
Are employees from outside organisations given appropriate fire safety information?	No

Comments

It should be ensured that employees from outside organisations are given information on the action to take in the event of fire. A fire action notice would provide this information.

Testing & Maintenance

Was testing & maintenance information available?	No
Are fire extinguishers subject to suitable test & maintenance?	N/A

Comments

Fire Safety documentation for the testing and maintenance of fire safety systems is held centrally at the ISHA Head Office. The ISHA Neighbourhood Officer has confirmed that these are up to date.

Fire Risk Assessment 1-29 Kinver House Version 7

Record Keeping

Vere fire safety records available?	No
	NO

Comments

Fire Safety documentation for the testing and maintenance of fire safety systems is held centrally at the ISHA Head Office. The ISHA Neighbourhood Officer has confirmed that these are up to date.

Tasks

Task 1

Source Version 1

Category Escape Routes & Fire Spread

Sub Category Fire Doors

Action Required Install smoke seals on the following doors:

Flat 28

Version 2: Attempts were made to access this flat, however it was not possible and therefore it cannot be confirmed if the remedial work recommended in this task has been

completed.

VERSION 4: access was not possible into this flat to assess whether this recommended remedial work has been completed.

Version 7, 20/09/2024

Accessed flat, no smoke seals present. This task remains

outstanding.

Priority Low

Status Identified

Owner Customer Homes

Due Date 11 December 2019



Source Version 2

Category Escape Routes & Fire Spread

Sub Category Ease of Use

Action Required Although the amount of items currently in escape routes is

not unreasonable, routes should be monitored to ensure

that a build-up of items does not impede escape.

Shoes and other items outside of flat 13.

VERSION 4:

Timber on fourth floor corridor.

Version 7, 20/09/2024

Timber removed from fourth floor, shoes remain outside

flat 13. This task remains outstanding.

Priority Advisory

Status Identified

Owner Neighbourhood Services

Due Date 18 August 2022

Task 3

Source Version 2

Category Signs & Notices

Sub Category Fire Door Signage

Action Required The staircase door on the first floor has a "fire door keep

locked" sign fixed. This should be replaced with a "fire

door keep shut" sign.

VERSION 3: this task is yet to be completed.

Version 7, 20/09/2024

This task remains outstanding.

Priority Low

Status Identified

Owner Neighbourhood Services

Due Date 18 August 2021







Source Version 3

Category Signs & Notices
Sub Category Fire Door Signage

Action Required Provide Fire Door Keep Closed signs on the following

doors:

A "Fire Door Keep Closed" sign should be fixed to both sides of the self closing staircase door on the third floor

Version 7, 20/09/2024

This task remains outstanding.

Priority Low

Status Identified

Owner Neighbourhood Services

Due Date 09 June 2021

Task 5

Source Version 3

Category Escape Routes & Fire Spread

Sub Category Fire Doors

Action Required The following doors should be kept locked shut:

VERSION 3: the doors to the gas meter cupboards, located

in the bin-store, should be kept locked shut.

Version 7, 20/09/2024

This task remains outstanding.

Priority Medium

Status Identified

Owner Neighbourhood Services

Due Date 08 December 2020





Page 32 of 35

Source Version 4

Category Fire Prevention
Sub Category Housekeeping

Action Required The electrical cupboard on the ground floor is currently

being used to store cleaners equipment and chemicals. This

should be removed.

Version 7, 20/09/2024

Lock changed to a non-standard lock so access cannot be gained to verify if completed. As a result this task remains

outstanding.

Priority High

Status Identified

Owner Neighbourhood Services

Due Date 19 July 2021





Task 7

Source Version 4

Category Fire Prevention

Sub Category Lightning

Action Required The lightning protection should be periodically inspected

by a competent person, to the frequency recommended in

BS EN 62305.

Version 7, 20/09/2024

Unable to verify on site if this has been completed. This

task remains outstanding.

Priority Medium

Status Identified

Owner Neighbourhood Services

Due Date 19 October 2021



Source Version 5

Category Escape Routes & Fire Spread

Sub Category Construction and Glazing

Action Required Carry out the following recommendations of the CHPKFE

report:

- Installation of suitable and sufficient cavity barriers

behind the top floor of the metal cladding

- Capping of the sandwich cladding panels where cut to

enclose the exposed insulation.

Version 4, 20/09/2024

Nothing on site to suggest this has been done. This task

remains outstanding.

Priority High

Status Identified

Owner Customer Homes

Due Date 02 January 2022

Task 9

Source Version 5

Category Escape Routes & Fire Spread

Sub Category Construction and Glazing

Action Required Should it become apparent that the timescale for the

completion of the CHPKFE recommended remedial work is to be protracted beyond reasonable timescales, then additional interim fire safety measures should be considered in line with the NFCC Guidance Document "Simultaneous Evacuation Guidance- Guidance to support a temporary change to a simultaneous evacuation strategy

in purpose built blocks of flats"

Version 7, 20/09/2024

Stay put guidance remains. This task remains outstanding.

Priority High

Status Identified

Owner Customer Homes

Due Date 02 January 2022

Risk Score

Risk Score

Moderate Risk

Next Assessment Due

30 September 2025

Likelihood	Potential Consequence		
	Slight Harm	Moderate Harm	Extreme Harm
High	Moderate	Substantial	Intolerable
Medium	Tolerable	Moderate	Substantial
Low	Trivial	Tolerable	Moderate

Likelihood

Low Unusually low likelihood of fire as a result of negligible potential sources of ignition.

Medium Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards

generally subject to appropriate controls (other than minor shortcomings).

High Lack of adequate controls applied to one or more significant fire hazards, such as to result in

significant increase in likelihood of fire.

Consequence

Slight Outbreak of fire unlikely to result in serious injury or death of any occupant (other than an

occupant sleeping in a room in which a fire occurs).

Moderate Outbreak of fire could foreseeably result in injury (including serious injury) of one or more

occupants, but it is unlikely to involve multiple fatalities.

Extreme Significant potential for serious injury or death of one or more occupants.