

Fire Risk Assessment 16 Summerhill Rd

Version 4

7 September 2023



Review Date: 7 September 2024 Score: Tolerable Risk Assessor: Mark Thomas

Contents

1	Action Plan Summary	3
2	Introduction	5
3]	Executive Summary	6
4]	Premises Details	7
5]	Fire Prevention	9
6]	Escape Routes & Fire Spread	. 12
7]	Detection & Warning	. 16
	Firefighting	
	Lighting	
10	Signs & Notices	. 20
11	Fire Safety Management	. 22
12	Tasks	. 24
13	Risk Score	. 26

Action Plan Summary

Task No	. Category	Sub Category	Action Required	Priority	Status	Action Taken	Date Completed
1	Fire Prevention	Housekeeping	The storage of combustible items in escape routes should be prohibited. VERSION 2: This task has not been completed and a number of items remain in this location, indeed, the number of items has increased since the last FRA. (Second photograph)	Medium	Identified		
2	Escape Routes & Fire Spread	Ease of Use	Obstructions should be removed from the escape routes in the following locations: Both staircase landings VERSION 2: This task has not been completed and a number of items remain in this location, indeed, the number of items has increased since the last FRA. (Second photograph)	Low	Identified		

3	Escape Routes & Fire Spread	Construction and Glazing	Provide fire stopping at the following locations:	Medium	Identified
			The electrical cupboards are located externally, in the access way to the dwellings 18a - 18c located at the rear of 16 Summerhill Rd. This means they are located beneath the flats in 16 Summerhill Rd above. Inspection within these cupboards found numerous penetrations into the flats above by pipes and cables which should be adequately fire stopped.		

Introduction

This report presents the significant findings of a fire risk assessment carried-out at the premises by QFSM Ltd. The scope, format and limitations of the fire risk assessment have been discussed and agreed with the client.

The scope of the assessment does not include individual dwellings. Notwithstanding any statement or recommendation made with respect to smoke/heat alarms within dwellings, it is always recommended as best practice to ensure that working smoke alarms are provided in all dwellings at least to a BS 5839-6 Category LD3 standard. These should ideally be Grade D alarms (mains powered with integral battery back-up), although Grade F alarms (battery powered only) are a reasonable short term measure.

The report includes an action plan which contains recommended tasks, each with a suggested due date. These due dates are only our suggestions, and may or may not be appropriate, depending on individual circumstances such as financial constraints and requirements of enforcing authorities.

The premises risk score was assessed at the time of the fire risk assessment, and a recommended review date has been provided. The actual level of risk may change over time, as a result of tasks being completed, or new risks arising. Regardless of the review date, the fire risk assessment should be reviewed regularly so as to keep it up to date and particularly if:

• there is reason to suspect that the fire risk assessment is no longer valid; or

• there has been a significant change in the matters to which the fire risk assessment relates.

If you have any queries please contact QFSM Ltd at office@qfsmltd.co.uk.

Executive Summary

A BS5839-6 Category LD3 fire alarm has been installed in the common parts of this building. This is contradictory to National Guidance for a building of this type (LGA Guidance - Fire Safety in Purpose Built Blocks of Flats) and could cause confusion where a stay put policy is in place. It is advised to consider removing the fire alarm in the common areas to align with the above national guidance.

There are some fire stopping concerns in the external electrical cupboards. These are located directly below flats and it cannot be confirmed if these penetrations compromise the flats and common parts above.

Giving consideration to the general fire safety arrangements within the building, and the tasks required as detailed within this report, it is assessed that this building presents a tolerable risk.

VERSION 2:

The previous FRA for this building was reviewed prior to this inspection, paying particular attention to any tasks generated by that FRA. During this inspection these tasks were inspected where access was possible, to ascertain if the recommended remedial work had been completed, and comments regarding the progress of any remedial work made accordingly.

Records for the testing and maintenance of fire safety related systems are not kept on site. These are managed centrally and are held at the ISHA Head Office.

The wall, floors and stairs in the common areas are of masonry/concrete construction.

There is a BS5839-6 fire alarm provided in the common parts of this building. This may been provided due to concerns over compartmentation within the building. No documentation regarding the cause and effect of the system was available and it cannot be confirmed whether the fire alarm in the common areas is interlinked to those installed within flats. The provision of a common fire alarm system contradicts National Guidance for a building of this type (general needs, purpose built, self contained flats).

Giving consideration to the general fire safety arrangements within the building, and the tasks recommended as detailed within this report, it is assessed that this building presents a tolerable risk.

This new version was created on 07/09/2023 and is not a review of the fire risk assessment. This is purely an on-site audit carried out at the request of the client to ascertain the progress of any action carried out against previous tasks identified in previous versions of this fire risk assessment.

Premises Details

Building Information

Address line 1	16 Summerhill Rd
Town	Islington
Postcode	N15 4HD
FRA Type	Type 3 – Common parts and flats (non- destructive)

Description

A Type 3 fire risk assessment includes the work involved in a Type 1 fire risk assessment, but goes beyond the scope of the FSO (though not the scope of the Housing Act). This risk assessment considers the arrangements for means of escape and fire detection (ie smoke alarms) within at least a sample of the flats. Within the flats, the inspection is non-destructive, but the fire resistance of doors to rooms is considered.

Measures to prevent fire are not considered unless (eg in the case of maintenance of the electrical and heating installations) the measures are within the control of, for example, the landlord.

A Type 3 fire risk assessment may sometimes be appropriate for rented flats if there is reason to suspect serious risk to residents in the event of a fire in their flats. (This might be, for example, because of the age of the block or reason for suspicion of widespread unauthorised material alterations). This type of fire risk assessment will not be possible in the case of long leasehold flats, as there is normally no right of access for freeholders.

Client	ISHA
Use	Purpose-built, self-contained flats
Number of floors - ground and above	3
Number of floors - below ground	0
Number of flats	6
Number of stair cores	2

Construction details

16 Summerhill Road comprises two stair-cores, with flats 2-5 located in one core and flats 7 and 8 in the other. Flats 1 and 6 have direct external access.

The building has brick walls with concrete stairs and floors, under a pitched tiled roof.

A loft hatch is located at the top of each staircase, however access to the roof space was not gained so it is not possible to comment on the suitability and provision of fire resisting compartmentation in this area.

External wall details

Brick and mortar external walls

External walls are of brick and mortar construction, with no combustible external wall systems visible within the scope of this FRA.

There is a mortar rendered recess on the front face of the building. The substrate to which the mortar is applied cannot be confirmed within the scope of this FRA.

Are there any private balconies?

People

16 Summerhill Rd

Version 4

Are there any people especially at risk from fire?

Not Known

No

Rendered recess above main entrance	
door	

Approach to flats	• Direct from stair
Approximate period of construction	1990-2000
Is the top occupied storey over 18 metres above access level?	No

Fire Prevention

Electrical

Are electrical installations and appliances free from any obvious defect?	Yes
Are fixed installations periodically inspected and tested?	Not Known
Are portable electrical appliances used?	No

Comments

Electrical cupboards located outside of the building and do not affect the common parts.

Documentation regarding the testing and maintenance of fixed electrical installations is held centrally by ISHA. The Neighbourhood Officer has confirmed these are all up to date.

There are electrical sockets in the common areas, presumably for use by cleaning staff. These were in good condition and showed no evidence of misuse by residents or visitors.



Electrical sockets within the staircase

Gas

Are gas installations and appliances free from any obvious defect?	N/A
Is gas equipment protected/located so as not to be prone to accidental damage?	N/A
Comments	

There is no gas provision or equipment in the common areas.

Heating

Treating	
Are fixed heating installations free from any obvious defect?	N/A
Are portable heaters used?	Y
	No
Comments	
There is no heating provision in the common areas.	
Cooking	
Does cooking take place on the premises?	No
Comments	
Cooking takes place within flats only and does not take place in the common par	ts.
Arson	
Is compiler accient around accomplic?	
Is security against arson reasonable?	Yes
Is there a reasonable absence of external fuels and ignition sources?	
	No
Comments	
Access was gained into this building via a secured main entrance door.	
CCTV cameras are installed externally. Whilst these cameras may have been installed reduce the risk of deliberate fire setting.	stalled for security purposes they also serve to
The main entrance door was found to be locked and secure, preventing unauthor	ised access.
There was some discarded soft furniture located against the front of the building.	
Housekeeping	
Is accumulation of combustibles or waste avoided?	
	No
Are there appropriate storage facilities for combustible & hazardous materials?	
	N/A
Comments	
Number of shoes and other items outside flat 7	
Other items located outside flat 8.	
Other fields rocated outside riat 0.	


Fire Risk Assessment 16 Summerhill Rd Version 4

Building Works

Are there any hot works being carried-out at this time?	No		
Are the premises free of any obvious signs of incorrect hot work procedures in the past?	Yes		
Smoking			
Are there suitable arrangements taken to prevent fires caused by smoking?	Yes		
Comments			
"No Smoking" signage is provided, with no evidence of smoking taking place in the common parts.			
Dangerous Substances			
Are dangerous substances present, or liable to be present?	No		
Lightning			
Is a lightning protection system installed?	No		

Escape Routes & Fire Spread

Ease of Use

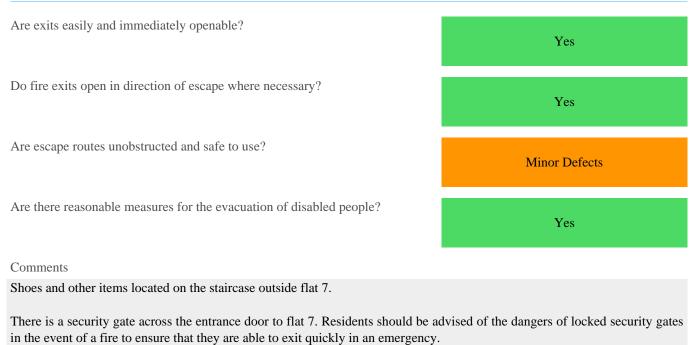


Dimensions

Are travel distances reasonable?

Is there sufficient exit capacity?

Yes
Yes

Fire Doors

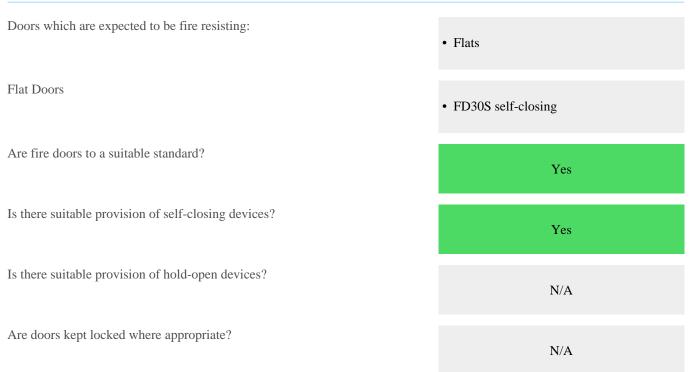

Comments

This Type 3 Fire Risk Assessment has considered the arrangements for means of escape within at least a sample of the flats. Within the flats, the inspection was non-destructive, but the fire resistance of doors to rooms was considered.

Access was gained into flat 4 which has an entrance door to FD30S SC standard of fire resistance. The internal doors which open onto the entrance hallway were not fire resisting.

The remainder of flat front doors within the building could not be assessed due to access. However, these all appear to be of the same age, condition and design of those which were accessed and were probably all installed at the same time. It is therefore reasonable to assume that they are of the same fire resisting standard.

The provision and condition of self closing devices, intumescent strips/cold smoke seals, and effective door closing action of these doors however could not be assessed and this should be confirmed ensure all doors afford FD30S SC standard of fire resistance.

VERSION 2: It was not possible to access any flat to assess flat entrance doors, however, from external examination only there does not appear to be any damage or defects in the doors and therefore it may be reasonably assumed the doors are of the same standard as noted in the previous FRA.

VERSION 3:

This Type 3 Fire Risk Assessment has considered the arrangements for means of escape within at least a sample of the flats. Within the flats, the inspection was non-destructive, but the fire resistance of doors to rooms was considered.

Access was gained into flat 2 which has an entrance door to FD30S SC notional standard of fire resistance. The internal doors which open onto the entrance hallway were not fire resisting.

The remainder of flat front doors within the building could not be assessed due to access. However, these all appear to be of the same age, condition and design of those which were accessed and were probably all installed at the same time. It is therefore reasonable to assume that they are of the same fire resisting standard.

The provision and condition of self closing devices, intumescent strips/cold smoke seals, and effective door closing action of these doors however could not be assessed and this should be confirmed ensure all doors afford FD30S SC standard of fire resistance.

Construction & Glazing

Are escape routes protected with suitable walls and floors?	Yes
Is there adequate compartmentation?	Minor Defects
Is there reasonable limitation of linings that might promote fire spread?	Yes
Glazing which is expected to be fire resisting, inc vision panels and fanlights:	• None
Is glazing reasonable and free from any obvious defects?	Yes

Comments

The electrical cupboards are located externally, in the access way to the dwellings 18a - 18c located at the rear of 16 Summerhill Rd. This means they are located beneath the flats in 16 Summerhill Rd above. Inspection within these cupboards found numerous penetrations into the flats above by pipes and cables which should be adequately fire stopped.

Dampers, Ducts & Chutes

Are there suitable measures to restrict fire spread via ducts and concealed spaces?

Comments

No dampers ducts or chutes evident.

Page 14 of 26

Fire Risk Assessment 16 Summerhill Rd Version 4 Yes

Smoke Ventilation

Areas where smoke ventilation is expected:	• Staircases
Staircases	• Openable Windows (with restrictors)
Is smoke ventilation reasonable and free from any obvious defects?	Yes

Comments

The openable window located in the staircase is positioned lower in the wall than the highest point of the 2nd floor flats entrance doorway. This is not compliant with ADB Vol 2 which recommends that the window should be positioned higher in the wall so that it is above the highest point of the second floor entrance door.

The building was constructed in 1994 when these building regulations would have applied and therefore it must have been approved by the relative building control body at that time.

Should any construction work be carried out in the future is is advised to consider providing additional ventilation in this staircase.

Detection & Warning

Control Equipment

Is an electrical fire alarm system expected?	No
Why not?	Purpose-built flats
Is a fire detection and/or alarm system provided?	No
Communal Areas	
System Category	• BS 5839 Pt6 Grade D Category L3
Cause & Effect	• Sounds alarm in communal areas
Is the control equipment suitably located?	N/A
Is the control equipment free from any obvious fault or defect?	N/A
Manual Fire Alarms	
Are there sufficient means of manually raising an alarm?	N/A
Are manual callpoints appropriately located and free from obvious defect?	N/A

Automatic Fire Detection

Is there sufficient provision of automatic fire detection?	N/A
Is the type of automatic fire detection suitable and free from obvious defect?	N/A

Comments

A BS5839-6 Category LD3 fire alarm has been installed in the common parts of this building.

This is contradictory to National Guidance for a building of this type (LGA Guidance - Fire Safety in Purpose Built Blocks of Flats) and could cause confusion where a stay put policy is in place.

It is advised to consider removing the fire alarm in the common areas to align with the above national guidance.

As part of this Type 3 Fire Risk Assessment access was gained into a sample flat to assess the provision and suitability of fire alarms. Access was gained into flat 4 which has a fire alarm provided to BS 5839-6 Category LD3 standard.

It is always recommended as best practice to ensure that working smoke alarms are provided in all dwellings at least to a BS 5839-6 Category LD3 standard. These should ideally be Grade D alarms (mains powered with integral battery back-up), although Grade F alarms (battery powered only) are a reasonable short term measure.

VERSION 2: This fire alarm has been removed


Audibility

Are there adequate means of alerting all relevant persons?

Yes


Firefighting

Fire Extinguishers

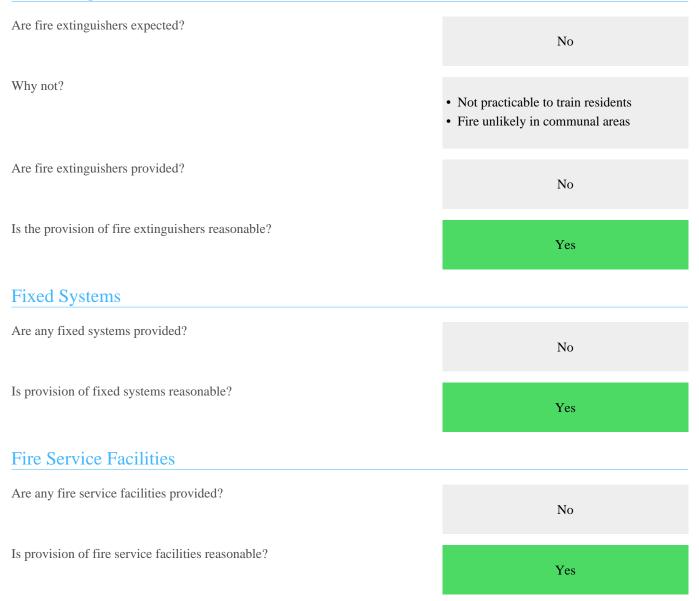

Lighting

Normal Lighting

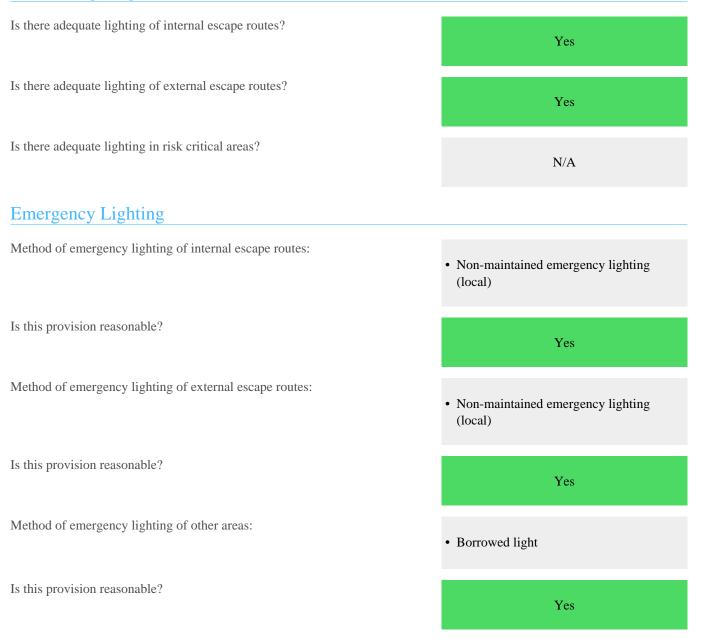

Comments

Although this assessment took place in daylight hours, it is reasonable to assume that there would be sufficient borrowed light from the street lighting provided on Summerhill Rd to aid escape.

Signs & Notices

Escape Routes

Is escape route signage necessary?	No
Why not?	Simple escape routesRoutes in ordinary use
Is escape route signage provided?	No
Is provision of escape route signage suitable?	Yes
Fire Doors	
Is there signage suitable for self-closing fire doors?	N/A
Is there signage suitable for locked fire doors?	N/A
Is there signage suitable for automatic fire doors?	N/A

Other Signs & Notices

Is there suitable signage for fire service facilities?	N/A
Are fire action notices suitable?	Yes
Are there suitable notices for fire extinguishers?	N/A
Is there suitable zone information for the fire alarm system?	N/A



Provided fire action notice

Fire Safety Management

Procedures & Arrangements

Current evacuation policy	Stay Put
Are fire action procedures suitable and appropriately documented?	Not Known
Are there suitable arrangements for calling the fire service?	N/A
Is there a suitable fire assembly point?	N/A
Are there suitable arrangements for the evacuation of disabled people?	Yes

Comments

These are general needs flats and as such no specific occupancy risk is identified. Tenants are presumed to be a typical cross section of public and could include visitors and contractors. It is assumed that all occupants and visitors are capable of using the means of escape unaided to reach a place of ultimate safety.

Training & Drills

Are staff regularly on the premises?	No
Are employees from outside organisations given appropriate fire safety information?	Yes
Comments	

Comments

A fire action notice is provided which would give employees from outside organisations information regarding action to be taken in the event of a fire.

Testing & Maintenance

Was testing & maintenance information available?	No
Are fire extinguishers subject to suitable test & maintenance?	N/A

Comments

Fire Safety documentation for the testing and maintenance of fire safety systems is held centrally at the ISHA Head Office. The ISHA Neighbourhood Officer has confirmed that these are up to date.

Fire Risk Assessment 16 Summerhill Rd Version 4

Record Keeping

Were fire safety records available?

No

Comments

Fire Safety documentation for the testing and maintenance of fire safety systems is held centrally at the ISHA Head Office. The ISHA Neighbourhood Officer has confirmed that these are up to date.

Fire Risk Assessment 16 Summerhill Rd Version 4

Tasks

Task 1

Source Version	1
Category	Fire Prevention
Sub Category	Housekeeping
Action Required	The storage of combustible items in escape routes should be prohibited.
	VERSION 2: This task has not been completed and a number of items remain in this location, indeed, the number of items has increased since the last FRA. (Second photograph)
Priority	Medium
Status	Identified
Owner	Neighbourhood Services
Due Date	7 February 2019



Task 2

Source Version	1		•
Category	Escape Routes & Fire Spread	INTI-	
Sub Category	Ease of Use		
Action Required	Obstructions should be removed from the escape routes in the following locations:		6
	Both staircase landings		
	VERSION 2: This task has not been completed and a number of items remain in this location, indeed, the number of items has increased since the last FRA. (Second photograph)		
Priority	Low		
Status	Identified		
Owner	Neighbourhood Services		
Due Date	15 November 2019		

Task 3

Source Version	1
Category	Escape Routes & Fire Spread
Sub Category	Construction and Glazing
Action Required	Provide fire stopping at the following locations:
	The electrical cupboards are located externally, in the access way to the dwellings 18a - 18c located at the rear of 16 Summerhill Rd. This means they are located beneath the flats in 16 Summerhill Rd above. Inspection within these cupboards found numerous penetrations into the flats above by pipes and cables which should be adequately fire stopped.
Priority	Medium
Status	Identified
Owner	Customer Homes
Due Date	7 February 2019



Likelihood

	Slight Harm	Moderate Harm	Extreme Harm
High	Moderate	Substantial	Intolerable
Medium	Tolerable	Moderate	Substantial
Low	Trivial	Tolerable	Moderate
Likelihood			
Low Un	Unusually low likelihood of fire as a result of negligible potential sources of ignition.		
	Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings).		
	Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire.		
Consequence			
-	Outbreak of fire unlikely to result in serious injury or death of any occupant (other than an occupant sleeping in a room in which a fire occurs).		
	Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatalities.		
Extreme Sig	Significant potential for serious injury or death of one or more occupants.		

Risk Score

Next Assessment Due

Tolerable Risk

7 September 2024

Potential Consequence