

Fire Risk Assessment

37A-B Davenant Road

Version 2

2 October 2023



Review Date: 2 October 2024

Score: Tolerable Risk

Assessor: Mark Thomas

Contents

1 Action Plan Summary	3
2 Introduction	6
3 Executive Summary	7
4 Premises Details	8
5 Fire Prevention	10
6 Escape Routes & Fire Spread	12
7 Detection & Warning	15
8 Firefighting	17
9 Lighting	18
10 Signs & Notices	19
11 Fire Safety Management	20
12 Tasks	22
13 Risk Score	25

Action Plan Summary

Task No.	Category	Sub Category	Action Required	Priority	Status	Action Taken	Date Completed
1	Fire Prevention	Housekeeping	The storage of combustible items in staircases should be prohibited.	Medium	Identified		
2	Fire Prevention	Smoking	No Smoking signage should be provided in the communal areas.	Low	Identified		
3	Escape Routes & Fire Spread	Ease of Use	Obstructions should be removed from the escape routes in the following locations: Obstructions should be removed from the staircase.	Medium	Identified		

4	Detection & Warning	Automatic Fire Detection	<p>If following an intrusive inspection of fire compartmentation it is deemed that there is a sufficient standard of compartmentation to support a stay-put policy (which is recommended for converted flats of a stay put standard), then consideration should be given to removing the common alarm. If it is considered to maintain a common fire alarm then it should be in line with LACoRS Fire detection and alarm system recommendations for a Three-or four-storey building converted into self-contained flats, which is :</p>	Advisory	Identified
			<p>A mixed system</p> <ul style="list-style-type: none"> • Grade A: LD2 coverage in the common areas and a heat alarm in each flat in the room/lobby opening onto the escape route (interlinked); and • Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat <p>(This is subject to the fire separation recommendations as given in LACoRS)</p>		
			<p>NB: it is always recommended that within each flat a fire alarm is provided to Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat.</p>		

5	Signs & Notices	Other Signage	Provide fire action notices which confirm the action to take in the event of fire.	Medium	Identified
6	Escape Routes & Fire Spread	Ease of Use	Bikes should not be stored as to obstruct escape routes.	Medium	Identified

Introduction

This report presents the significant findings of a fire risk assessment carried-out at the premises by QFSM Ltd. The scope, format and limitations of the fire risk assessment have been discussed and agreed with the client.

The scope of the assessment does not include individual dwellings. Notwithstanding any statement or recommendation made with respect to smoke/heat alarms within dwellings, it is always recommended as best practice to ensure that working smoke alarms are provided in all dwellings at least to a BS 5839-6 Category LD3 standard. These should ideally be Grade D alarms (mains powered with integral battery back-up), although Grade F alarms (battery powered only) are a reasonable short term measure.

The report includes an action plan which contains recommended tasks, each with a suggested due date. These due dates are only our suggestions, and may or may not be appropriate, depending on individual circumstances such as financial constraints and requirements of enforcing authorities.

The premises risk score was assessed at the time of the fire risk assessment, and a recommended review date has been provided. The actual level of risk may change over time, as a result of tasks being completed, or new risks arising. Regardless of the review date, the fire risk assessment should be reviewed regularly so as to keep it up to date and particularly if:

- there is reason to suspect that the fire risk assessment is no longer valid; or
- there has been a significant change in the matters to which the fire risk assessment relates.

If you have any queries please contact QFSM Ltd at office@qfsm ltd.co.uk.

Executive Summary

The previous FRA for this building was reviewed prior to this inspection, paying particular attention to any tasks generated by that FRA. During this inspection these tasks were inspected where access was possible, to ascertain if the recommended remedial work had been completed, and comments regarding the progress of any remedial work made accordingly.

Records for the testing and maintenance of fire safety related systems are not kept on site. These are managed centrally and are held at the ISHA Head Office.

This building was originally a single private dwelling converted at some point, probably before the 1980's, to form separate flats. The building regulation standards in use today were not introduced until 1991, however, some of the principles within the early editions of ADB have been applied and generally the building meets the current guidance with the exception of smoke ventilation within the staircase. A common fire alarm (to BS5839-6 LD3 standard) has been provided in the common parts of the building. It is not known whether this system is interlinked to the fire alarms provided within the flats themselves. If following an intrusive inspection of fire compartmentation it is deemed that there is a sufficient standard of compartmentation to support a stay-put policy (which is recommended for converted flats of a stay put standard), then consideration should be given to removing the common alarm. If it is considered to maintain a common fire alarm then it should be in line with LACoRS Fire detection and alarm system recommendations for a Three-or four-storey building converted into self-contained flats, which is :

A mixed system

- Grade A: LD2 coverage in the common areas and a heat alarm in each flat in the room/lobby opening onto the escape route (interlinked); and
 - Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat
- (This is subject to the fire separation recommendations as given in LACoRS)

NB: it is always recommended that within each flat a fire alarm is provided to Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat.

There were a number of combustibles and obstructions in the common area which should be removed.

There is no Fire Action Notice provided. It is imperative that residents and visitors are given clear instructions as to the action they should take in the event of a fire.

Giving consideration to the general fire safety arrangements within the building, and the tasks recommended as detailed within this report, it is assessed that this building presents a tolerable risk.

This new version was created on 02/10/2023 and is not a review of the fire risk assessment. This is purely an on-site audit carried out at the request of the client to ascertain the progress of any action carried out against previous tasks identified in previous versions of this fire risk assessment.

Premises Details

Address line 1

37A-B Davenant Road

Town

Islington

Postcode

N19 3NW

FRA Type

Type 1 - Common parts only (non-destructive)

Description

A Type 1 fire risk assessment has been conducted at this building. This means the inspection of the building has been non-destructive. As well as considering the arrangements for means of escape, the fire risk assessment has included, where possible, the examination of a sample of flat entrance doors. It has also considered, so far as reasonably practicable, the separating construction between the flats and the common parts without any intrusive examination of construction. This Type of fire risk assessment has not involved entry to flats beyond the area of the flat entrance door.

Client

ISHA

Building Information

Use	Converted, self-contained flats
Number of floors - ground and above	3
Number of floors - below ground	0
Number of flats	2
Number of stair cores	1
Approach to flats	<ul style="list-style-type: none">• Direct from stair
Approximate period of construction	Pre 1900
Is the top occupied storey over 18 metres above access level?	No

Construction details

Traditional brick construction with intermediate timber floors and a covered pitched roof.

Access to common area via secure door entry system, flat A is accessed off the communal entrance lobby at ground floor level, flat B is accessed via the communal stairwell at first floor level.

It is assumed flat A is located over the ground and part of the first floor level and flat B located over the first and second floor levels

External wall details

External walls of brick and mortar construction.

Are there any private balconies?	No
----------------------------------	----

People

Are there any people especially at risk from fire?	Not Known
--	-----------

Fire Prevention

Electrical

Are electrical installations and appliances free from any obvious defect?

Yes

Are fixed installations periodically inspected and tested?

Yes

Are portable electrical appliances used?

No

Comments

Documentation regarding the testing and maintenance of fixed electrical installations is held centrally by ISHA. The Neighbourhood Officer has confirmed these are all up to date.

Gas

Are gas installations and appliances free from any obvious defect?

N/A

Is gas equipment protected/located so as not to be prone to accidental damage?

N/A

Comments

There is no gas provision or equipment in the common areas.

Heating

Are fixed heating installations free from any obvious defect?

N/A

Are portable heaters used?

No

Comments

There is no heating provision in the common areas.

Cooking

Does cooking take place on the premises?

No

Comments

Cooking takes place within flats only and does not take place in the common parts.

Arson

Is security against arson reasonable?

Yes

Is there a reasonable absence of external fuels and ignition sources?

Yes

Comments

The main entrance door was found to be locked and secure, preventing unauthorised access.

Housekeeping

Is accumulation of combustibles or waste avoided?

No

Are there appropriate storage facilities for combustible & hazardous materials?

N/A

Comments

Combustibles located on the staircase, outside flat B.

Building Works

Are there any hot works being carried-out at this time?

No

Are the premises free of any obvious signs of incorrect hot work procedures in the past?

Yes

Smoking

Are there suitable arrangements taken to prevent fires caused by smoking?

No

Comments

"No Smoking" signage should be provided in the communal areas.

Dangerous Substances

Are dangerous substances present, or liable to be present?

No

Lightning

Is a lightning protection system installed?

No

Escape Routes & Fire Spread

Ease of Use

Are exits easily and immediately openable?

Yes

Do fire exits open in direction of escape where necessary?

N/A

Are escape routes unobstructed and safe to use?

No

Are there reasonable measures for the evacuation of disabled people?

Yes

Comments

Tenants are presumed to be a typical cross section of the public and could include visitors and contractors. It is assumed that all occupants and visitors are capable of using the means of escape unaided to reach a place of ultimate safety.

There was a bicycle stored in the entrance hallway and obstructions noted on the staircase.

The provision of thumb turn devices on final exits means the doors can be opened without the use of a key.



The provision of thumb turn devices on final exits means the doors

Dimensions

Are travel distances reasonable?

Yes

Is there sufficient exit capacity?

Yes

Fire Doors

Doors which are expected to be fire resisting:

- Electrical Cupboards
- Flats

Electrical Cupboard Doors

- FD30S

Flat Doors

- Not confirmed

Are fire doors to a suitable standard?

Yes

Is there suitable provision of self-closing devices?

Yes

Is there suitable provision of hold-open devices?

N/A

Are doors kept locked where appropriate?

Yes

Comments

It is understood that communal doors are inspected regularly by neighbourhood officers and formally recorded in the quarterly/6 monthly estate inspections with residents. Records are held with the neighbourhood officers. Flat entrance doors are inspected during the annual LGSR visits where the gas engineers record on their PDA if a door closer exists and intumescent strips and cold smoke seals exist.

The flat entrance doors within the building could not be assessed due to access. However from external examination only, the flat entrance doors appear to be flush timber original doors from the time of the conversion which should provide a notional 30 minutes fire resistance. All flat entrance doors appear to be of the same age, condition and design and were probably all installed at the same time. It is therefore reasonable to assume that they are of the same FD30 (notional) fire resisting standard. The provision and condition of self closing devices, intumescent strips/cold smoke seals, and effective door closing action of these doors however could not be assessed and this should be confirmed ensure all doors afford FD30S SC standard of fire resistance.



Example of typical flat entrance door
(flat A)

Construction & Glazing

Are escape routes protected with suitable walls and floors?

Yes

Is there adequate compartmentation?

Yes

Is there reasonable limitation of linings that might promote fire spread?

Yes

Glazing which is expected to be fire resisting, inc vision panels and fanlights:

• None

Is glazing reasonable and free from any obvious defects?

Yes

Dampers, Ducts & Chutes

Are there suitable measures to restrict fire spread via ducts and concealed spaces?

Yes

Comments

No Dampers, Ducts or Chutes evident.

Smoke Ventilation

Areas where smoke ventilation is expected:

• Staircases

Staircases

• Openable Doors

Is smoke ventilation reasonable and free from any obvious defects?

Yes

Comments

Ventilation would be made by means of the openable main entrance door. Although this is located below the entrance door to flat B, the travel distance is short. In addition it would not be practicable to provide additional ventilation and therefore this arrangement is considered reasonable.

Detection & Warning

Is an electrical fire alarm system expected?

No

Why not?

Converted flats of stay-put standard

Is a fire detection and/or alarm system provided?

Yes

Areas covered

- Communal areas

Communal Areas

System Category

- BS 5839 Pt6 Grade D Category LD3

Cause & Effect

- Sounds alarm in communal areas

Control Equipment

Is the control equipment suitably located?

N/A

Is the control equipment free from any obvious fault or defect?

N/A

Manual Fire Alarms

Are there sufficient means of manually raising an alarm?

N/A

Are manual callpoints appropriately located and free from obvious defect?

N/A

Automatic Fire Detection

Is there sufficient provision of automatic fire detection?

No

Is the type of automatic fire detection suitable and free from obvious defect?

Yes

Comments

This building was originally a single private dwelling converted at some point, probably before the 1980's, to form separate flats. The building regulation standards in use today were not introduced until 1991, however, some of the principles within the early editions of ADB have been applied and generally the building meets the current guidance with the exception of smoke ventilation within the staircase.

However, a BS5839 Part 6 fire alarm system has been installed in the staircase, (it cannot be confirmed within the scope of this Type 1 FRA if this extends into the flats) which prompts Simultaneous Evacuation rather than the more common approach of Stay Put. The Simultaneous Evacuation philosophy is not incorrect, but requires management consideration. If following an intrusive inspection of fire compartmentation it is deemed that there is a sufficient standard of compartmentation to support a stay-put policy (which is recommended for converted flats of a stay put standard), then consideration should be given to removing this alarm. If it is considered to maintain a common fire alarm then it should be in line with LACoRS Fire detection and alarm system recommendations for a Three-or four-storey building converted into self-contained flats, which is :

A mixed system

- Grade A: LD2 coverage in the common areas and a heat alarm in each flat in the room/lobby opening onto the escape route (interlinked); and
 - Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat
- (This is subject to the fire separation recommendations as given in LACoRS)

Audibility

Are there adequate means of alerting all relevant persons?

Minor Defects

Comments

Please see comments and task generated in Automatic Fire Detection section of this report.

Firefighting

Fire Extinguishers

Are fire extinguishers expected?

No

Why not?

- Not practicable to train residents
- Fire unlikely in communal areas
- Vandalism concerns

Are fire extinguishers provided?

No

Is the provision of fire extinguishers reasonable?

Yes

Fixed Systems

Are any fixed systems provided?

No

Is provision of fixed systems reasonable?

Yes

Fire Service Facilities

Are any fire service facilities provided?

No

Is provision of fire service facilities reasonable?

Yes

Lighting

Normal Lighting

Is there adequate lighting of internal escape routes?

Yes

Is there adequate lighting of external escape routes?

N/A

Is there adequate lighting in risk critical areas?

N/A

Emergency Lighting

Method of emergency lighting of internal escape routes:

- Maintained emergency lighting (local)

Is this provision reasonable?

Yes

Method of emergency lighting of external escape routes:

- Borrowed light

Is this provision reasonable?

Yes

Method of emergency lighting of other areas:

- Not applicable

Is this provision reasonable?

Yes

Comments

Based on the guidance of Table 9 in Approved Document B, Emergency lighting is not generally required in blocks of flats comprising of ground and first floor only, particularly where borrowed light, on a separate electrical sub-circuit is available.

Signs & Notices

Escape Routes

Is escape route signage necessary?

No

Why not?

- Simple escape routes
- Routes in ordinary use

Is escape route signage provided?

No

Is provision of escape route signage suitable?

Yes

Fire Doors

Is there signage suitable for self-closing fire doors?

N/A

Is there signage suitable for locked fire doors?

Yes

Is there signage suitable for automatic fire doors?

N/A

Other Signs & Notices

Is there suitable signage for fire service facilities?

N/A

Are fire action notices suitable?

No

Are there suitable notices for fire extinguishers?

N/A

Is there suitable zone information for the fire alarm system?

N/A

Comments

Provide fire action notices which confirm the action to take in the event of fire.

Fire Safety Management

Procedures & Arrangements

Current evacuation policy

Simultaneous

Further details

The provision of a fire alarm in the common area of this building suggests a simultaneous evacuation policy is in place. It is generally recommended to have a stay-put policy in place in converted flats of a stay-put standard where compartmentation has been confirmed as being of a sufficient standard to support such a policy.

Are fire action procedures suitable and appropriately documented?

Not Known

Are there suitable arrangements for calling the fire service?

N/A

Is there a suitable fire assembly point?

N/A

Are there suitable arrangements for the evacuation of disabled people?

Yes

Comments

These are general needs flats and as such no specific occupancy risk is identified. Tenants are presumed to be a typical cross section of public and could include visitors and contractors. It is assumed that all occupants and visitors are capable of using the means of escape unaided to reach a place of ultimate safety.

Training & Drills

Are staff regularly on the premises?

No

Are employees from outside organisations given appropriate fire safety information?

No

Comments

Provide fire action notices which confirm the action to take in the event of fire.

Testing & Maintenance

Was testing & maintenance information available?

No

Are fire extinguishers subject to suitable test & maintenance?

N/A

Comments

Fire Safety documentation for the testing and maintenance of fire safety systems is held centrally at the ISHA Head Office. The ISHA Neighbourhood Officer has confirmed that these are up to date.

Record Keeping

Were fire safety records available?

No


Comments

Fire Safety documentation for the testing and maintenance of fire safety systems is held centrally at the ISHA Head Office. The ISHA Neighbourhood Officer has confirmed that these are up to date.

Tasks

Task 1

Source Version	1
Category	Fire Prevention
Sub Category	Housekeeping
Action Required	The storage of combustible items in staircases should be prohibited.
Priority	Medium
Status	Identified
Owner	Neighbourhood Services
Due Date	1 December 2020

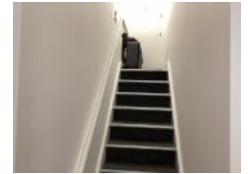


Task 2

Source Version	1
Category	Fire Prevention
Sub Category	Smoking
Action Required	No Smoking signage should be provided in the communal areas.
Priority	Low
Status	Identified
Owner	Neighbourhood Services
Due Date	2 June 2021

Task 3

Source Version	1
Category	Escape Routes & Fire Spread
Sub Category	Ease of Use
Action Required	Obstructions should be removed from the escape routes in the following locations: Obstructions should be removed from the staircase.
Priority	Medium
Status	Identified
Owner	Neighbourhood Services
Due Date	1 December 2020

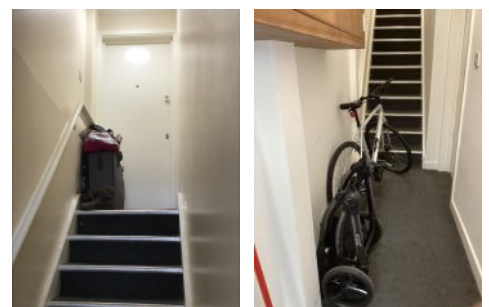

Task 4


Source Version	1
Category	Detection & Warning
Sub Category	Automatic Fire Detection
Action Required	<p>If following an intrusive inspection of fire compartmentation it is deemed that there is a sufficient standard of compartmentation to support a stay-put policy (which is recommended for converted flats of a stay put standard), then consideration should be given to removing the common alarm. If it is considered to maintain a common fire alarm then it should be in line with LACoRS Fire detection and alarm system recommendations for a Three-or four-storey building converted into self-contained flats, which is :</p> <p>A mixed system</p> <ul style="list-style-type: none">• Grade A: LD2 coverage in the common areas and a heat alarm in each flat in the room/lobby opening onto the escape route (interlinked); and• Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat (This is subject to the fire separation recommendations as given in LACoRS) <p>NB: it is always recommended that within each flat a fire alarm is provided to Grade D: LD3 coverage in each flat (non-interlinked smoke alarm in the room/lobby opening onto the escape route) to protect the sleeping occupants of the flat.</p>
Priority	Advisory
Status	Identified
Owner	Customer Homes
Due Date	2 June 2022

Task 5

Source Version	1
Category	Signs & Notices
Sub Category	Other Signage
Action Required	Provide fire action notices which confirm the action to take in the event of fire.
Priority	Medium
Status	Identified
Owner	Neighbourhood Services
Due Date	1 December 2020

Task 6

Source Version	1
Category	Escape Routes & Fire Spread
Sub Category	Ease of Use
Action Required	Bikes should not be stored as to obstruct escape routes.
Priority	Medium
Status	Identified
Owner	Neighbourhood Services
Due Date	1 December 2020

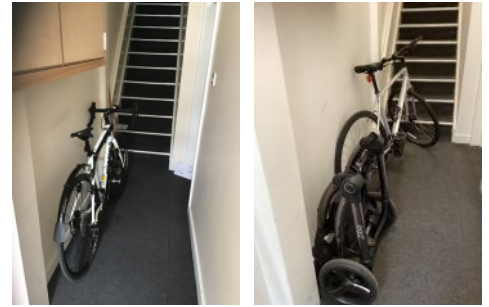

Risk Score

Risk Score

Tolerable Risk

Next Assessment Due

2 October 2024

Likelihood	Potential Consequence		
	Slight Harm	Moderate Harm	Extreme Harm
High	Moderate	Substantial	Intolerable
Medium	Tolerable	Moderate	Substantial
Low	Trivial	Tolerable	Moderate

Likelihood

Low Unusually low likelihood of fire as a result of negligible potential sources of ignition.

Medium Normal fire hazards (e.g. potential ignition sources) for this type of occupancy, with fire hazards generally subject to appropriate controls (other than minor shortcomings).

High Lack of adequate controls applied to one or more significant fire hazards, such as to result in significant increase in likelihood of fire.

Consequence

Slight Outbreak of fire unlikely to result in serious injury or death of any occupant (other than an occupant sleeping in a room in which a fire occurs).

Moderate Outbreak of fire could foreseeably result in injury (including serious injury) of one or more occupants, but it is unlikely to involve multiple fatalities.

Extreme Significant potential for serious injury or death of one or more occupants.